

SMC910

TECHNICAL DATA

Invisible LED, SMD

SMC910 are AlGaAs LEDs mounted on a ceramic SMD package and sealed with silicone or epoxy resin for damp proof. On forward bias, it emits a radiation of typical 8 mW at a peak wavelength of 910 nm.

Specifications

- Structure: AlGaAs
- Peak Wavelength: typ. 910 nm
- Optical Output Power: typ. 5 mW
- · Package: Ceramic SMD, silicon or epoxy resin

Absolute Maximum Ratings (T_a=25°C)

Item	Symbol	Value	Unit
Power Dissipation	PD	160	mW
Forward Current	I _F	100	mA
Pulse Forward Current *1	I _{FP}	500	mA
Reverse Voltage	V _R	5	V
Operating Temperature	T _{opr}	-30 +80	°C
Storage Temperature	T _{stg}	-30 +80	°C
Soldering Temperature *2	T _{sol}	255	°C



*² must be completed within 5 seconds


Electro-Optical Characteristics

Item	Symbol	Condition	Min.	Тур.	Max.	Unit
Forward Voltage	V _F	l _F = 50 mA	-	1.30	1.50	V
Reverse Current	I _R	$V_R = 5 V$	-	-	10	μA
Total Radiated Power	Po	l _F = 50 mA	2.5	5.0	-	mW
Radiation Intensity	Ι _Ε	l _F = 50 mA	-	2.0	-	mW/sr
Peak Wavelength	λ_{P}	l _F = 50 mA	900	910	920	nm
Half Width	Δλ	l _F = 50 mA	-	40	-	nm
Viewing Half Angle	Θ _{1/2}	l _F = 50 mA	-	±63	-	deg.
Rise Time	t _r	l _F = 50 mA	-	1000	-	ns
Fall Time	t _f	l _F = 50 mA	-	400	-	ns

Radiation Intensity is measured by Tektronix J-6512 Total Radiated Power is measured by Photodyne #500

Notes

- Do not view directly into the emitting area of the LED during operation!
- The above specifications are for reference purpose only and subjected to change without prior notice.

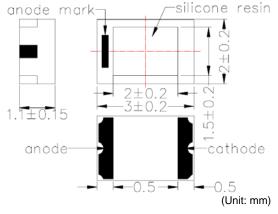


28.11.2011






Recommended Land Layout (Unit: mm)

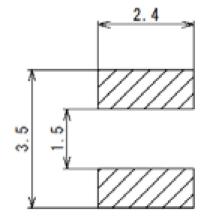

1. Soldering Conditions

- DO NOT apply any stress to the lead particularly when heat. •
- After soldering the LEDs should be protected from mechanical shock or vibration until the • LEDs return to room temperature.
- When it is necessary to clamp the LEDs to prevent soldering failure, it is important to • minimize the mechanical stress on the LEDs.

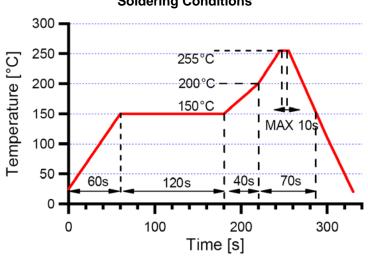

Soldering Conditions

2. Static Electricity

- The LEDs are very sensitive to Static Electricity and surge voltage. So it is recommended that a wrist band or an anti-electrostatic glove be used when handling the LEDs.
- All devices, equipment and machinery must be grounded properly. It is recommended that • precautions should be taken against surge voltage to the equipment that mounts the LEDs.

